# Reversible Motor



## 90 Watt

Square Flange 90mm x 90mm

Short Duty, 30 Minute Rating
Continuously Acting Internal Brakes
Quick Reversal Of Direction Of Rotation
Terminal Box or Lead Wires For Connection
Totally Enclosed Fan Cooled Aluminium Body



## **Specifications:**

Model	Supply	Freq.	Stall Torque Nm	Rated Torque Nm	Rated Speed RPM	Rated Current Amp	Cap. μF
5IX4□90	Single Phase 230V	50	0.86	0.67	1300	0.54	4
5IY4□90	Three Phase 230V	50	0.86	0.73	1250	0.44	-
5IY4□90	Three Phase 415V	50	1.10	0.61	1350	0.25	_
5IX2□90	Single Phase 230V	50	0.45	0.34	2700	0.46	2.5
5IY2□90	Three Phase 230V	50	0.39	0.33	2600	0.47	_
5IY2□90	Three Phase 415V	50	0.56	0.34	2700	0.26	_

☐ Indicates type of Shaft, G - Gear, R - Round, F - Frame, C - Custom

#### **Gearmotor Torque Table:**

The maximum permissible torque is 20 Nm

No Load speed of Motor at 50Hz is approx. 1440RPM

50Hz	50Hz Unit: Nm																			
RPM	480	400	288	240	192	160	115	96	80	57	48	40	29	24	19	16	14	12	9.6	8
Gear Ratio	3	3.6	5	6	7.5	9	12.5	15	18	25	30	36	50	60	75	90	100	120	150	180
Output Torque	1.7	2.0	2.8	3.3	4.2	5.0	6.3	7.5	9.1	11.2	13.4	16.1	20.0	20.0	20.0	20.0	20.0	20.0	20.0	20.0

The Gear boxes are sold seperately.

A coloured background indicates gear shaft rotation in same direction as motor shaft.

A white background indicates gear shaft rotation in opposite direction to the motor shaft.

The speed of geared motor is calculated by dividing motor's no load speed by the gear ratio.

The actual speed is less than the displayed value, depending upon the load.


Characteristics, specifications and dimensions are subject to change without notice.




# Reversible Motor


#### Dimensions:


### Motor, Gearbox with Terminal Box

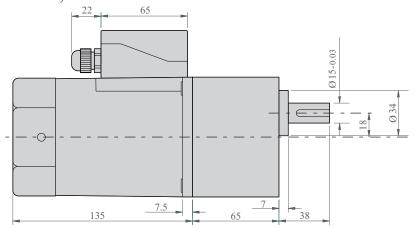

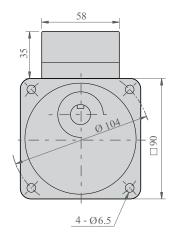



#### Motor Round Shaft with Terminal Box

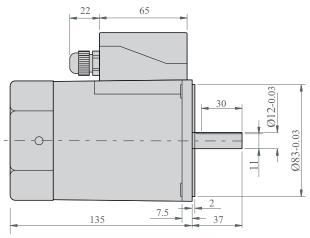

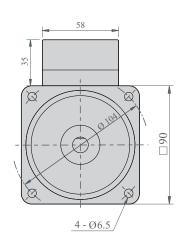



### Motor, Gearbox with Lead Wires

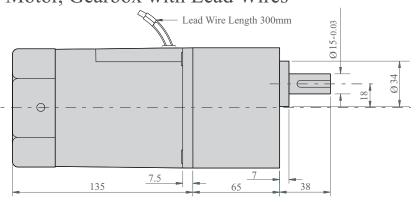

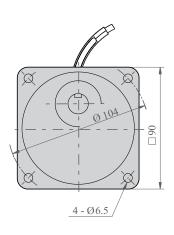

Key & Keyway



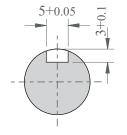


Max. Weight: Motor - 2.7 kg Gear Box - 1.7 kg

# Reversible Motor




#### Wiring Diagrams:

Wiring Diagram for Single Phase Motor

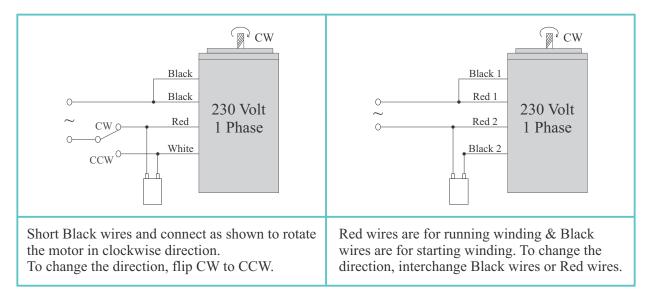

#### Wiring Diagram for Three Phase Motor

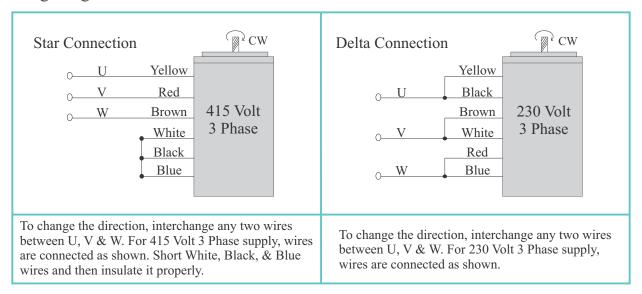

Change the direction of motor only after it stops rotating. If the attempt is made during rotation, motor may not change the direction or change the direction after some time.